

Work Order ID 150153

Wednesday, August 24, 2016 11:42:41 AM

150153

Page 1

Item ID: D119-796-241TRN

Accept

N900040100

Setup Start

NS1

Revision ID:

Stop

NS2

Item Name: Crosstube Turning Detail

Start Date: 8/24/2016 Start Qty: 1.00

1

Cust Item ID:

Required Date: 9/12/2016 Req'd Qty: 1.00

1

Customer:

Reference:

Approvals:

Process Plan:

DAS

Date:

AUG 24 2016

Tooling:

Date:

QC:

21

Date:

SPC (Y/N):

Date:

Run Start

NR1

Stop

NR2Sequence ID/
Work Center IDOperation
DescriptionSet Up/
Run Hours

Tool ID

Tool #

Plan
CodeAccept
QtyReject
QtyReject
NumberInsp.
Stamp

Draw Nbr

Revision Nbr

D119-796-241

I

100

0.04

100

Mori Seiki

MORI SEIKI CNC LATHE LARGE

Memo

0.33

Mori Seiki CNC Lathe Large

1-Fill tube with sand & install plugs on both ends as per Folio FB298

2-Turn first side as per Folio FB298

3-Blend transition lines only, **do not sand whole tube**:

FOLIO REV: **AA**DWG REV: **I**

*Use mill bastard file, brush file repeatedly with file card.

*Do not use sandpaper coarser than 320 grit.

1 0 11/1/15

16/9/15

110

QC2- Inspect parts off machine FAI/FAIB

0.00

110

QC

Memo

0.00

Quality Control

1 0 11/1/15

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date :	Step #:	QTY Effective :		MRB (QSI042) Approval	
Description Work Order Deviation		Disposition			
				Completed By	
				Lead hand / Supervisor Approval Verification	
				QC / QA Coordinator Approval	
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐			
OTHER : ☐					

Work Order ID 150153***150153***

Page 2

Wednesday, August 24, 2016 11:42:41 AM

Item ID: D119-796-241TRN

Accept

N900040100

Setup Start

NS1

Revision ID:

Stop

NS2

Item Name: Crosstube Turning Detail

Start Date: 8/24/2016 Start Qty: 1.00

1

Cust Item ID:

Required Date: 9/12/2016 Req'd Qty: 1.00

1

Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Run Start

NR1

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop

NR2

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
120	MORI SEIKI CNC LATHE LARGE	0.00				1	0		
120									
Mori Seiki	Memo	0.48							
Mori Seiki CNC Lathe Large	1-Turn second side as per Folio FB298								
	2-Blend transition lines only, **do not sand whole tube**: *Use mill bastard file, brush file repeatedly with file card. *Do not use sandpaper coarser than 320 grit. FOLIO REV: <u>44</u> DWG REV: <u>I</u> 3-Remove sand and plugs								
	4- scribe batch # and part # as per dwg								
130	QC2- Inspect parts off machine FAI/FAIB	0.00				1	0		
130									
QC	Memo	0.00							
Quality Control									

16/9/27

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date : _____	Step #: _____	QTY Effective : _____		MRB (QSI042) Approval	
Description Work Order Deviation		Disposition			
				Completed By	
				Lead hand / Supervisor Approval Verification	
				QC / QA Coordinator Approval	
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐			
OTHER : _____					

Work Order ID 150153***150153***

Page 3

Wednesday, August 24, 2016 11:42:41 AM

Item ID: D119-796-241TRN

Accept

N900040100

Setup Start

NS1

Revision ID:

Stop

NS2

Item Name: Crosstube Turning Detail

Start Date: 8/24/2016 Start Qty: 1.00

1

Cust Item ID:

Required Date: 9/12/2016 Req'd Qty: 1.00

1

Customer:

Reference:

Approvals:

Process Plan:

Date:

Tooling:

Date:

Run Start

NR1

QC:

Date:

SPC (Y/N):

Date:

Stop

NR2Sequence ID/
Work Center IDOperation
DescriptionSet Up/
Run Hours

Tool ID

Tool #

Plan
CodeAccept
QtyReject
QtyReject
NumberInsp.
Stamp

140

QC8- Inspect parts - second check

0.00

140

QC

Memo

0.00

Quality Control

DA

47

9-85

16-09-30

145

0.00

145

Crosstubes

Memo

0.14

Crosstubes

GRIND ONLY TRANSITION LINES SMOOTH LONGITUDE WAY.

JW 16-10-12

150

0.02

150

HandFXtube

Memo

0.11

Hand Finishing Crosstubes

1- PRESSURE WASH X-TUBE INSIDE AND OUT

2- ALODINE AND ACID ETCH X-TUBE INSIDE AND OUT. USE RED
SCOTCH BRITE

JW 16-10-12

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date :	Step #:	QTY Effective :		MRB (QSI042) Approval	
Description Work Order Deviation		Disposition		Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval	
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐			
		OTHER : _____			

Work Order ID 150153

Wednesday, August 24, 2016 11:42:41 AM

150153

Page 4

Item ID: D119-796-241TRN**Accept*****N900040100*****Setup Start *NS1*****Revision ID:****Stop *NS2*****Item Name:** Crosstube Turning Detail**Start Date:** 8/24/2016 **Start Qty:** 1.00***1*****Cust Item ID:****Required Date:** 9/12/2016 **Req'd Qty:** 1.00***1*****Customer:****Reference:****Approvals:** **Process Plan:** _____ **Date:** _____ **Tooling:** _____ **Date:** _____**Run Start *NR1*****QC:** _____ **Date:** _____ **SPC (Y/N):** _____ **Date:** _____**Stop *NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

160

QC7-Inspect Chemical Conversion Coat

0.00

160

QC

Memo

0.00

Quality Control

DPZ 16-10-13

170

Packaging

0.00

170

Packaging

Memo

0.00

Packaging

LOCATION : LG014

TW 16-10-13

180

QC21- Final Inspection - Work Order Release

0.00

180

QC

Memo

0.02

Quality Control

DAS
21
9-89

OCT 13 2016

VS 16/10/13
[Signature]

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐																																																																																			
Date :	Step #:	QTY Effective :		MRB (QSI042) Approval																																																																																	
Description Work Order Deviation		Disposition																																																																																			
				Completed By																																																																																	
				Lead hand / Supervisor Approval Verification																																																																																	
				QC / QA Coordinator Approval																																																																																	
<table border="1" style="width:100%; border-collapse: collapse;"> <thead> <tr> <th colspan="3" style="text-align: left;">Root Cause</th> <th colspan="3" style="text-align: left;">FAULT CATEGORY</th> </tr> </thead> <tbody> <tr> <td>Environment ☐</td> <td>☐ No Re-verification</td> <td>☐ Pressure/Forced</td> <td>☐ Temperature/Cure</td> <td>☐ Power Loss/Surge</td> <td>☐ Positioned Wrong</td> </tr> <tr> <td>Design ☐</td> <td>☐ Operator</td> <td>☐ Bending</td> <td>☐ Set-up</td> <td>☐ Folio/Program</td> <td>☐ Outside Dimensions</td> </tr> <tr> <td>Doc/Data ☐</td> <td>☐ Offset/Setup</td> <td>☐ Centre Not Concentric</td> <td>☐ BOM/Route</td> <td>☐ Grain</td> <td>☐ Over/Under tolerance</td> </tr> <tr> <td>Equip/Tooling ☐</td> <td>☐ Supplier</td> <td>☐ Cracks</td> <td>☐ Broken/Damage/Defect</td> <td>☐ Weld</td> <td>☐ Part Incorrect</td> </tr> <tr> <td>Handling/Pre ☐</td> <td>☐ Training</td> <td>☐ Crimp/Kink/Ripple/Wave</td> <td>☐ Inspection Incomplete/Unqualified</td> <td>☐ Wrong Stock Pulled</td> <td>☐ Part Lost/Missing</td> </tr> <tr> <td>Material ☐</td> <td>☐ Use for Testing</td> <td>☐ Cuffs</td> <td>☐ Contamination</td> <td>☐ Out of Sequence</td> <td>☐ Part Moved</td> </tr> <tr> <td>Internal Transport ☐</td> <td>☐ Poor Information</td> <td>☐ Crushing</td> <td>☐ Countersink</td> <td>☐ Off-set</td> <td>☐ Drawing</td> </tr> <tr> <td>Tribal Knowledge ☐</td> <td>☐ Rushing</td> <td>☐ Heat Treat</td> <td>☐ Cut Too Short</td> <td>☐ Mislabeled</td> <td>☐ Finish</td> </tr> <tr> <td>LOA ☐</td> <td>☐ Product Improvement</td> <td>☐ Wave/Twist in Tube</td> <td>☐ Instructions Incomplete/Unclear</td> <td>☐ Fit/Function</td> <td>☐ Misread</td> </tr> <tr> <td>Substation ☐</td> <td>☐ Process Improvement</td> <td>☐ Marks/Chatter</td> <td>☐ Drill Holes</td> <td>☐ Misaligned/off center</td> <td>☐ Turning Sequence</td> </tr> <tr> <td>Past Expiry Date ☐</td> <td>☐ Manufacturing Process</td> <td colspan="4" rowspan="2"></td> </tr> <tr> <td>Misidentified ☐</td> <td>☐ Past Due</td> </tr> <tr> <td colspan="2"></td> <td colspan="4" style="text-align: left;">OTHER :</td> </tr> </tbody> </table>						Root Cause			FAULT CATEGORY			Environment ☐	☐ No Re-verification	☐ Pressure/Forced	☐ Temperature/Cure	☐ Power Loss/Surge	☐ Positioned Wrong	Design ☐	☐ Operator	☐ Bending	☐ Set-up	☐ Folio/Program	☐ Outside Dimensions	Doc/Data ☐	☐ Offset/Setup	☐ Centre Not Concentric	☐ BOM/Route	☐ Grain	☐ Over/Under tolerance	Equip/Tooling ☐	☐ Supplier	☐ Cracks	☐ Broken/Damage/Defect	☐ Weld	☐ Part Incorrect	Handling/Pre ☐	☐ Training	☐ Crimp/Kink/Ripple/Wave	☐ Inspection Incomplete/Unqualified	☐ Wrong Stock Pulled	☐ Part Lost/Missing	Material ☐	☐ Use for Testing	☐ Cuffs	☐ Contamination	☐ Out of Sequence	☐ Part Moved	Internal Transport ☐	☐ Poor Information	☐ Crushing	☐ Countersink	☐ Off-set	☐ Drawing	Tribal Knowledge ☐	☐ Rushing	☐ Heat Treat	☐ Cut Too Short	☐ Mislabeled	☐ Finish	LOA ☐	☐ Product Improvement	☐ Wave/Twist in Tube	☐ Instructions Incomplete/Unclear	☐ Fit/Function	☐ Misread	Substation ☐	☐ Process Improvement	☐ Marks/Chatter	☐ Drill Holes	☐ Misaligned/off center	☐ Turning Sequence	Past Expiry Date ☐	☐ Manufacturing Process					Misidentified ☐	☐ Past Due			OTHER :			
Root Cause			FAULT CATEGORY																																																																																		
Environment ☐	☐ No Re-verification	☐ Pressure/Forced	☐ Temperature/Cure	☐ Power Loss/Surge	☐ Positioned Wrong																																																																																
Design ☐	☐ Operator	☐ Bending	☐ Set-up	☐ Folio/Program	☐ Outside Dimensions																																																																																
Doc/Data ☐	☐ Offset/Setup	☐ Centre Not Concentric	☐ BOM/Route	☐ Grain	☐ Over/Under tolerance																																																																																
Equip/Tooling ☐	☐ Supplier	☐ Cracks	☐ Broken/Damage/Defect	☐ Weld	☐ Part Incorrect																																																																																
Handling/Pre ☐	☐ Training	☐ Crimp/Kink/Ripple/Wave	☐ Inspection Incomplete/Unqualified	☐ Wrong Stock Pulled	☐ Part Lost/Missing																																																																																
Material ☐	☐ Use for Testing	☐ Cuffs	☐ Contamination	☐ Out of Sequence	☐ Part Moved																																																																																
Internal Transport ☐	☐ Poor Information	☐ Crushing	☐ Countersink	☐ Off-set	☐ Drawing																																																																																
Tribal Knowledge ☐	☐ Rushing	☐ Heat Treat	☐ Cut Too Short	☐ Mislabeled	☐ Finish																																																																																
LOA ☐	☐ Product Improvement	☐ Wave/Twist in Tube	☐ Instructions Incomplete/Unclear	☐ Fit/Function	☐ Misread																																																																																
Substation ☐	☐ Process Improvement	☐ Marks/Chatter	☐ Drill Holes	☐ Misaligned/off center	☐ Turning Sequence																																																																																
Past Expiry Date ☐	☐ Manufacturing Process																																																																																				
Misidentified ☐	☐ Past Due																																																																																				
		OTHER :																																																																																			

Picklist Print

Wednesday, August 24, 2016 11:42:45 AM

Page 1

Work Order ID: 150153

150153

Parent Item: D119-796-241TRN

D119-796-241TRN

Parent Item Name: Crosstube Turning Detail

Start Date: 8/24/2016

Required Date: 9/12/2016

Start Qty: 1.00

Required Qty: 1.00

Comments:

IPP REV A RQ 14/05/27 VERIFIED BY DD
16.05.04 AS PER DWG REV.I DD VERF:JLM

IPP REV:B

Component Item ID/ Item Name	Replacement Item ID	Mfg/ Purch	Bin Item	Primary Location	Last Location	Route Seq ID	Unit of Measure	Qty on Hand	Qty per Kit	Total Qty	Qty Issued	Date Issued	Status
---------------------------------	------------------------	---------------	-------------	---------------------	------------------	-----------------	--------------------	----------------	-------------	--------------	---------------	----------------	--------

D6023-106

Manufactured

No

100

Each

8.0000

1

1

D6023-106

Crosstube Material

Location

Loc Qty

Loc Code

LG003

8

139411

8

14526

[Handwritten signature]

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval		
Description Work Order Deviation				Disposition				Completed By	
								Lead hand / Supervisor Approval Verification	
Root Cause		FAULT CATEGORY							
Environment ☐	☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐			
Design ☐	☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐			
Doc/Data ☐	☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐			
Equip/Tooling ☐	☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐			
Handling/Pre ☐	☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐			
Material ☐	☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐			
Internal Transport ☐	☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐			
Tribal Knowledge ☐	☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐			
LOA ☐	☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐			
Substation ☐	☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐			
Past Expiry Date ☐	☐	Manufacturing Process ☐	OTHER : _____						
Misidentified ☐	☐	Past Due ☐							


DART AEROSPACE LTD		Work Order:	150153
Description: Crosstube Assembly (AW119 MKII Aft)		Part Number:	D119-796-241TRN
Inspection Dwg: D119-796-241 Rev: I		Page 1 of 2	

FIRST ARTICLE INSPECTION CHECKLIST

Inspection Sheet Drawing Dimension		Tolerance	Actual Dimension	Accept	Reject	Method of Inspection	Comments
SIDE A	5.88	+/-0.030	5.88	✓		↑	
	2.516	+0.005/-0.000	2.520	✓			
	2.626	+0.005/-0.000	2.632	✓			
	2.627	+0.005/-0.000	2.632	✓			
	2.798	+0.005/-0.000	2.803	✓			
	2.799	+0.005/-0.000	2.804	✓			
	2.989	+0.005/-0.000	2.994	✓			
	3.191	+0.005/-0.000	3.195	✓			
	3.200	+0.005/-0.000	3.20		✓		Vernier 08
SIDE B	5.88	+/-0.030	5.88			↑	
	2.516	+0.005/-0.000	2.521	✓			
	2.626	+0.005/-0.000	2.630	✓			
	2.627	+0.005/-0.000	2.630	✓			
	2.798	+0.005/-0.000	2.632	✓			
	2.799	+0.005/-0.000	2.802	✓			
	2.989	+0.005/-0.000	2.884	✓			
	3.191	+0.005/-0.000	2.994	✓			
	3.200	+0.005/-0.000	3.193	✓			
			3.200		✓		Vernier 08
	105.71	+/-0.020	105.71	✓		tape	

DART AEROSPACE LTD	Work Order: 150153
Description: Crosstube Assembly (AW119 MKII Aft)	Part Number: D119-796-241TRN
Inspection Dwg: D119-796-241 Rev: I	Page 2 of 2

WALL THICKNESS MEASUREMENT

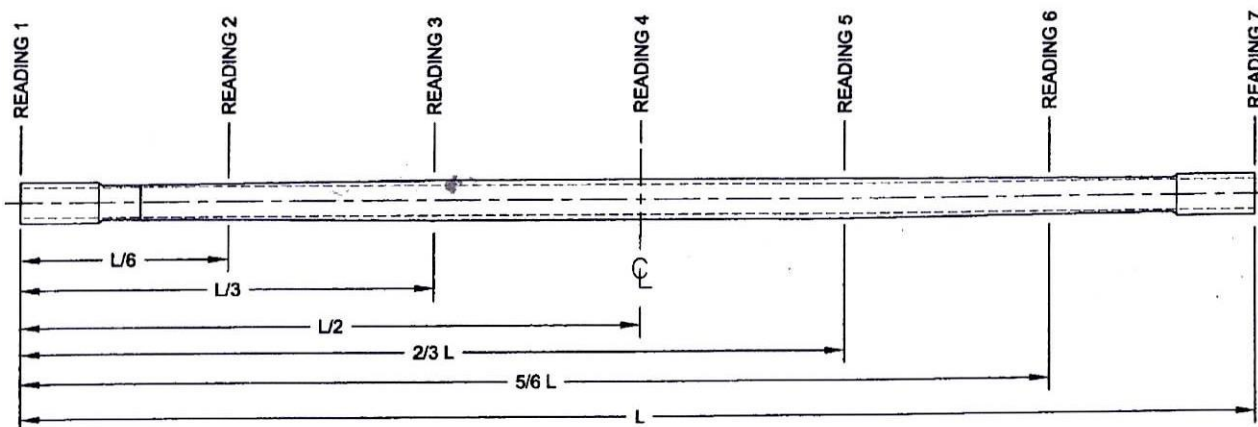

Location	WALL THICKNESS MEASUREMENT (IN)				Deviation Δw (max-min)	TOLERANCE
	w1	w2	w3	w4		
READING 1 L= 0"	.123	.131	.131	.131	0.008	0.030"
READING 2 L= 17.62	.203	.191	.209	.218	0.027	
READING 3 L= 35.24	.301	.291	.309	.318	0.027	
READING 4 L= 52.86	.478	.480	.483	.481	0.005	0.063
READING 5 L= 70.48	.295	.304	.313	.307	0.018	
READING 6 L= 88.10	.196	.211	.213	.197	0.017	0.030"
READING 7 L= 105.72	.133	.143	.124	.116	0.039*	


Calibration Result

Actual Block Thickness: 11.500

Sitescan 250 Measured Thickness: 11.500

Measured by: VHF	Audited by: 9-89	Preliminary Approval:
Date: 16/9/27	Date: 16/09/30	Date:

Rev	Date	Change	Revised by	Approved
A	14.09.18	New Issue (P/O D119-796-201)	KJ	
B	15.03.12	Dimensions updated per Dwg Rev F	KJ	
C	15.04.14	Tolerance dimensions revised on Wall Thickness table	KJ	
D	15.05.14	Tolerances revised per Dwg Rev G	KJ	
E	15.09.09	Dwg Rev updated	KJ	
F	16.05.27	Dwg Rev updated	KJ	

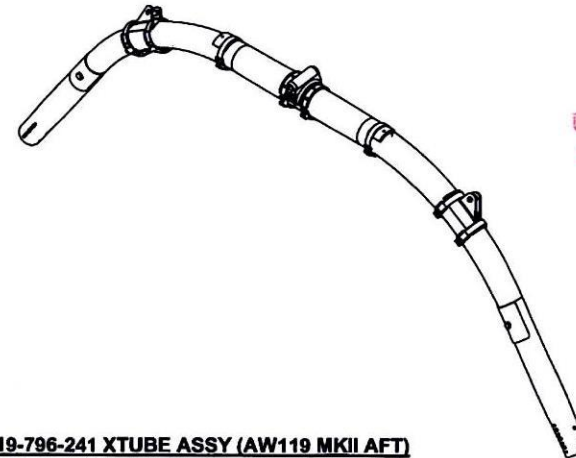

SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO. 150153

ML3
160824

D119-796-241 XTUBE ASSY (AW119 MKII AFT)

NOTES:


- 1) MATERIAL: N/A
- 2) FINISH: APPLY MATTE CLEAR COAT PER QSI 005 4.2
MASK D5134-041/-042 DAMPER SUPPORT ASSEMBLIES, D5136-1/-2 CONTACT PADS AS WELL AS
UNDERSIDE OF CROSSTUBE AS SHOWN (B4-2, HATCHED AREA).
PAINT OUTSIDE PER DART QSI 005 4.2 AFTER APPLYING CLEAR COAT
DO NOT APPLY FINISH (PAINT OR CLEAR COAT) TO CUFFS IN LOCATION SHOWN, MASK PRIOR TO FINISHING
- 3) TOLERANCES: PER DART QSI 018 UNLESS OTHERWISE NOTED
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED
- 5) BREAK SHARP EDGES: N/A
- 6) IDENTIFICATION: IDENTIFY USING PART NUMBER "D119-796-241" AND BATCH NUMBER
ON INSIDE OF CUFF PER QSI 044 6.4
- 7) WEIGHT: 26.26 lbs
- 8) EXTREME CARE MUST BE TAKEN TO PROTECT THE OUTSIDE SURFACE OF THE TUBE.
THE OUTSIDE SURFACE MUST BE SMOOTH AND FREE FROM DEFECTS SUCH AS
SCRATCHES, NICKS OR DENTS. DEFECTS UP TO 0.005 MAY BE BLENDED OUT
LONGITUDINALLY. CIRCUMFERENTIAL GRIND MARKS ARE UNACCEPTABLE.
- 9) INSTALL D5122-1 CENTER SUPPORT HAND TIGHT ONLY. DO NOT TORQUE. INSTALL RED
TAG TO INDICATE "D5122-1 CENTER SUPPORT MUST BE BONDED PER IIN-D119-796 PRIOR TO FLIGHT".
- 10) PRIOR TO FINISHING, ABRASE MATING SURFACES OF D5136-1/-2 AND SURFACE OF
CROSSTUBE WITH SCOTCH BRITE 7447 RED AND REMOVE RESIDUE WITH DUPONT
4105S WASH 'N' WIPE DEGREASER. APPLY A 0.100" MIN THK LAYER OF PROSEAL 890
ON THE INSIDE CONCAVE SURFACE OF THE D5136-1/-2 CONTACT PADS AND INSTALL
AT AN 8.4" OFFSET FROM THE CROSSTUBE BENDING PLANE. INSTALL MS21920-25
CLAMPS AND D5123-5 CLAMP CUSHIONS WHILE WET. PRIOR TO PACKAGING, RE-CHECK
TORQUE ON CLAMPS AFTER PROSEAL 890 SEALANT HAS CURED FOR 72 HOURS.
- 11) TORQUE MS21920 CLAMPS 80 - 100 IN-LB. ENSURE AT LEAST 1.5 THREADS SHOWING IN
SAFETY. THE NUT HAS NOT BOTTOMED-OUT AFTER TORQUING AND THE NUT IS FACING AFT.
- 12) PRIOR TO FINISHING, POSITION AND INSTALL D5134-041/-042 DAMPER SUPPORTS USING JIG DT10085.
ABRADE MATING SURFACES OF THE D5134-041/-042 DAMPER SUPPORTS AND CROSSTUBE WITH
SCOTCH BRITE 7447 RED AND REMOVE RESIDUE WITH DUPONT 4105S WASH 'N' WIPE
DEGREASER. APPLY A 0.100" MIN THK LAYER OF PROSEAL 890 ON THE INSIDE CONCAVE SURFACE
OF THE D5134-041/-042. INSTALL MS21920-25 CLAMPS AND D5123-1 CLAMP CUSHIONS WHILE WET.
PRIOR TO PACKAGING, RE-CHECK TORQUE ON CLAMPS AFTER PROSEAL 890 SEALANT HAS CURED
FOR 72 HOURS.
- 13) PRIOR TO FINISHING, ABRASE MATING SURFACES OF CROSSTUBE AND D5152-043 WITH
SCOTCH BRITE 7447 RED AND REMOVE RESIDUE WITH DUPONT 4105S WASH 'N' WIPE DEGREASER.
INSTALL D5152-043 WITH LAYER OF PROSEAL 890 ON INSIDE CONCAVE SURFACE, 0.100" MIN THK
LOCATE D5152-043 USING TOOL DT10112.

I	D6023-106 MATERIAL REPLACES D6009-106. D5136-1/-2 & D5134-041/-042 NOW INSTALLED ON PRIMER.	AP	15.10.13
H	NOTE 9 RE-WRITTEN. BONDING INSTRUCTIONS MOVED TO IIN. SEE PREVIOUS REV FOR DETAILS.	AP	15.07.02
G	FINISHING ORDER ADJUSTED. UPDATE BEND TOLERANCE AND TRN DETAIL TOLERANCE TO MATCH D119-796-141 DWG	AP	15.04.24
F	REMOVED PRIMER/PAINT ON CUFFS, 2.516 WAS 2.500 (C8-5)	AP	15.02.03
E	D5152-043 WAS D5150-3, SCOTCH BRITE 7447 RED WAS 180 GRIT SANDPAPER	DB	15.01.15
D	ADD D5150-3 STEP POST (2X), MOVED INSPECTION WINDOW DETAIL TO SHT 1, MODIFIED NOTES ON SH 1 & 3	DB	14.11.25
C	CR3212-4-07 RIVETS WAS CR3212-4-05 RIVETS, RADIUS BLOCK WAS NUT PLATE ASSEMBLY (BOM), REMOVED 7.5 DEG CUFF HOLE OFFSET (A1-3), REDUCED CUFF DIA TO 2.500 (C8-5), ADD INSPECTION WINDOW	AP	14.10.23
B	ORIENTATION OF D5122-1 CENTER SUPPORT WAS CORRECTED. D5123-5 ADDED UNDER D5136-1/-2 CONTACT PADS. ADDED D2873-043 NUT PLATE ASSY & CR3212-4-05 RIVETS. ADDED REFERENCE TO SKIDTUBES FOR LOCATING CUFF HOLES. RE-ORGANIZED NOTES, REMOVED REDUNDANT INFORMATION.	AP	14.09.08
A	NEW ISSUE	AP	14.08.07
REV.	DESCRIPTION	BY	DATE
DESIGN	AP	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA DRAWING NO. D119-796-241 TITLE XTUBE ASSY (AW119 MKII AFT) DATE 15.10.13	
DRAWN	AP		
CHECKED	AJS		
MFG. APPR.	JLM		
APPROVED	WM		
DE APPR.	DS	NTS THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL. IT IS TO BE SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	

RELEASED
2015-11-04
ECW 15-692

APPROVED


ITEM	QTY	P/N	DESCRIPTION
	X	D119-796-241	XTUBE ASSY (AW119 MKII AFT)
1	1	D119-796-241BND	CROSSTUBE, AFT
2	4	D2873-043	RADIUS BLOCK
3	1	D5122-1	CENTER SUPPORT
4	6	D5123-1	CLAMP CUSHION
5	2	D5123-5	CLAMP CUSHION
6	1	D5134-041	DAMPER SUPPORT ASSY, LH
7	1	D5134-042	DAMPER SUPPORT ASSY, RH
8	1	D5136-1	CONTACT PAD, LH
9	1	D5136-2	CONTACT PAD, RH
10	2	D5152-043	AFT POST MOUNT ASSY
11	16	CR3212-4-07	RIVET, BLIND CSK
12	6	MS21920-25	CLAMP
13	2	MS21920-28	CLAMP

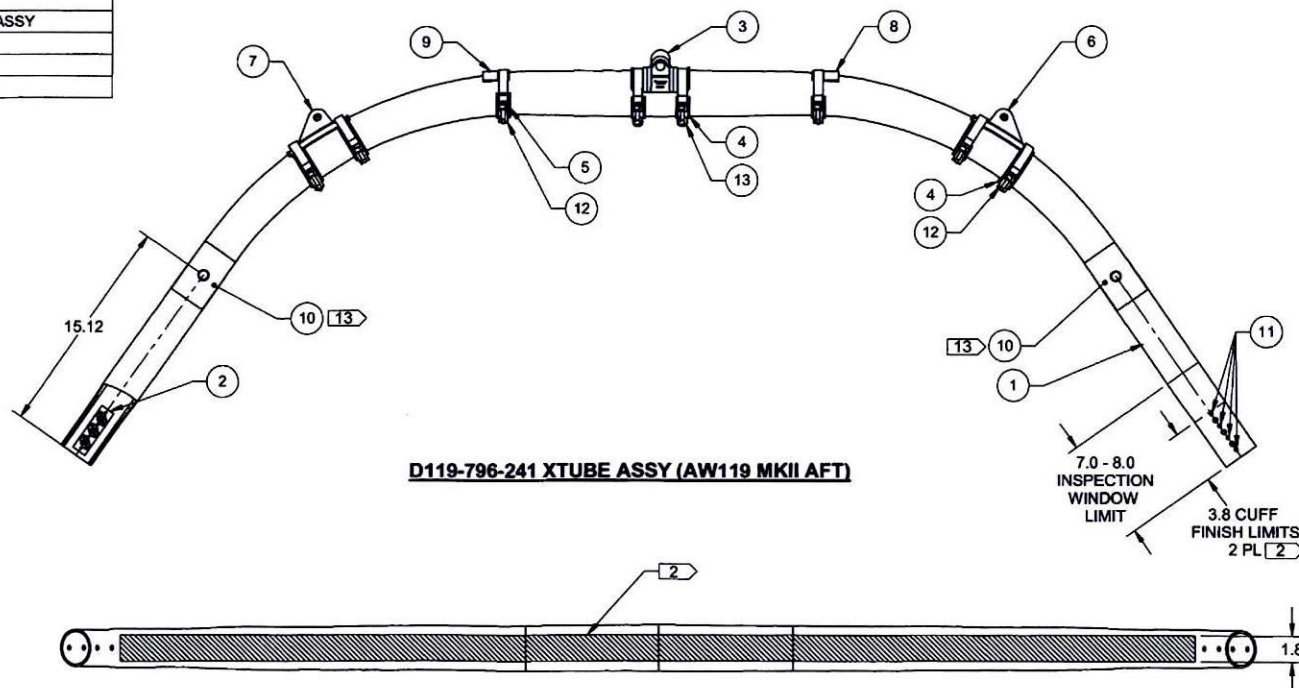


RELEASED
2015-11-04


APPROVED

DESIGN	AP	DART AEROSPACE LTD	
DRAWN	AP	HAWKESBURY, ONTARIO, CANADA	
CHECKED	AJS	DRAWING NO.	REV. 1
MFG. APPR.	JLM	D119-796-241	SHEET 2 OF 7
APPROVED	WM	TITLE	SCALE
DE APPR.	DS	XTUBE ASSY (AW119 MKII AFT)	NTS
DATE	15.10.13	COPYRIGHT © 2014 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	

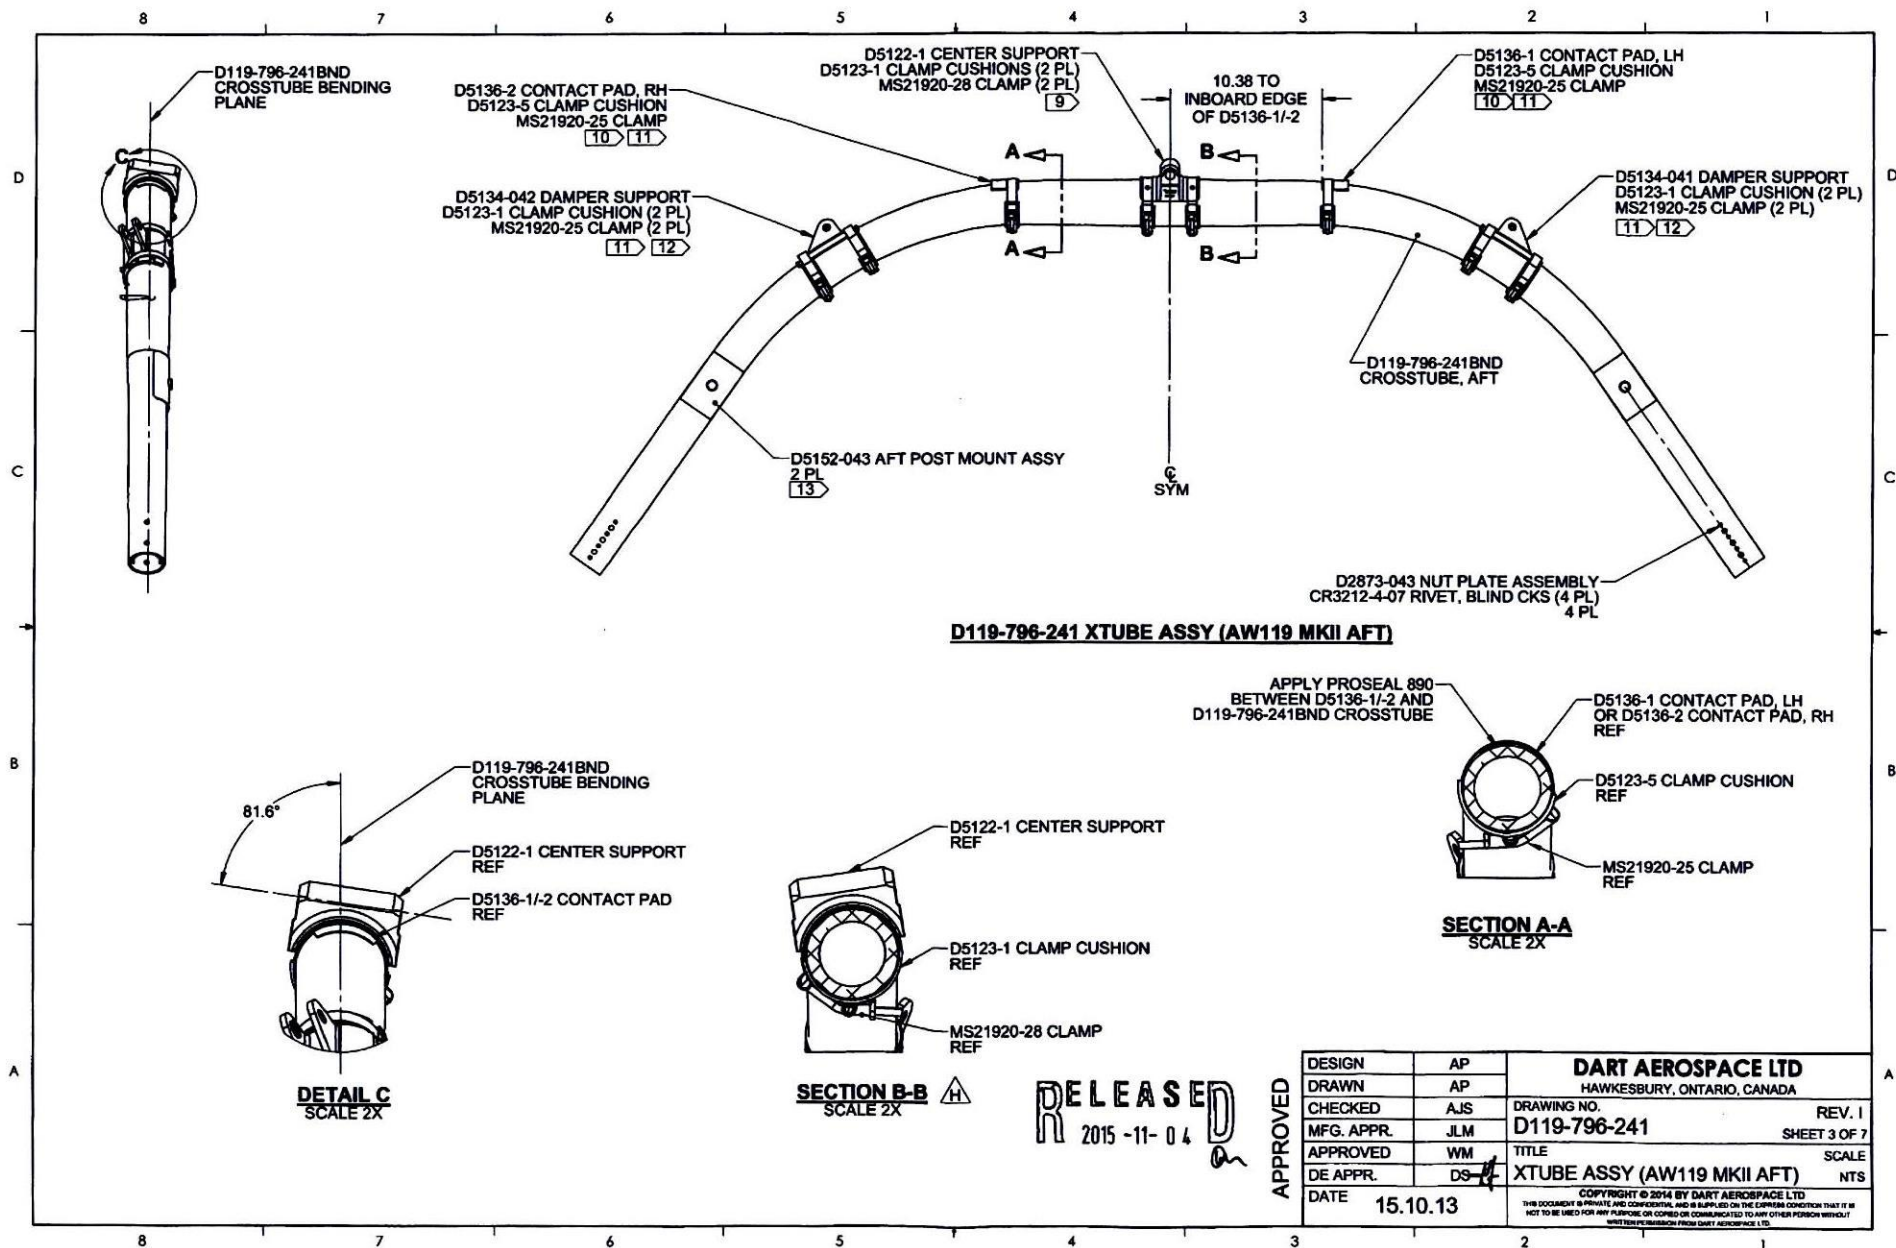


DESIGN	AP	DART AEROSPACE LTD	
DRAWN	AP	HAWKESBURY, ONTARIO, CANADA	
CHECKED	AJS	DRAWING NO.	REV. 1
MFG. APPR.	JLM	D119-796-241	SHEET 3 OF 7
APPROVED	WM	TITLE	SCALE
DE APPR.	DS	XTUBE ASSY (AW119 MKII AFT)	NTS
DATE	15.10.13	COPYRIGHT © 2014 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL, AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	

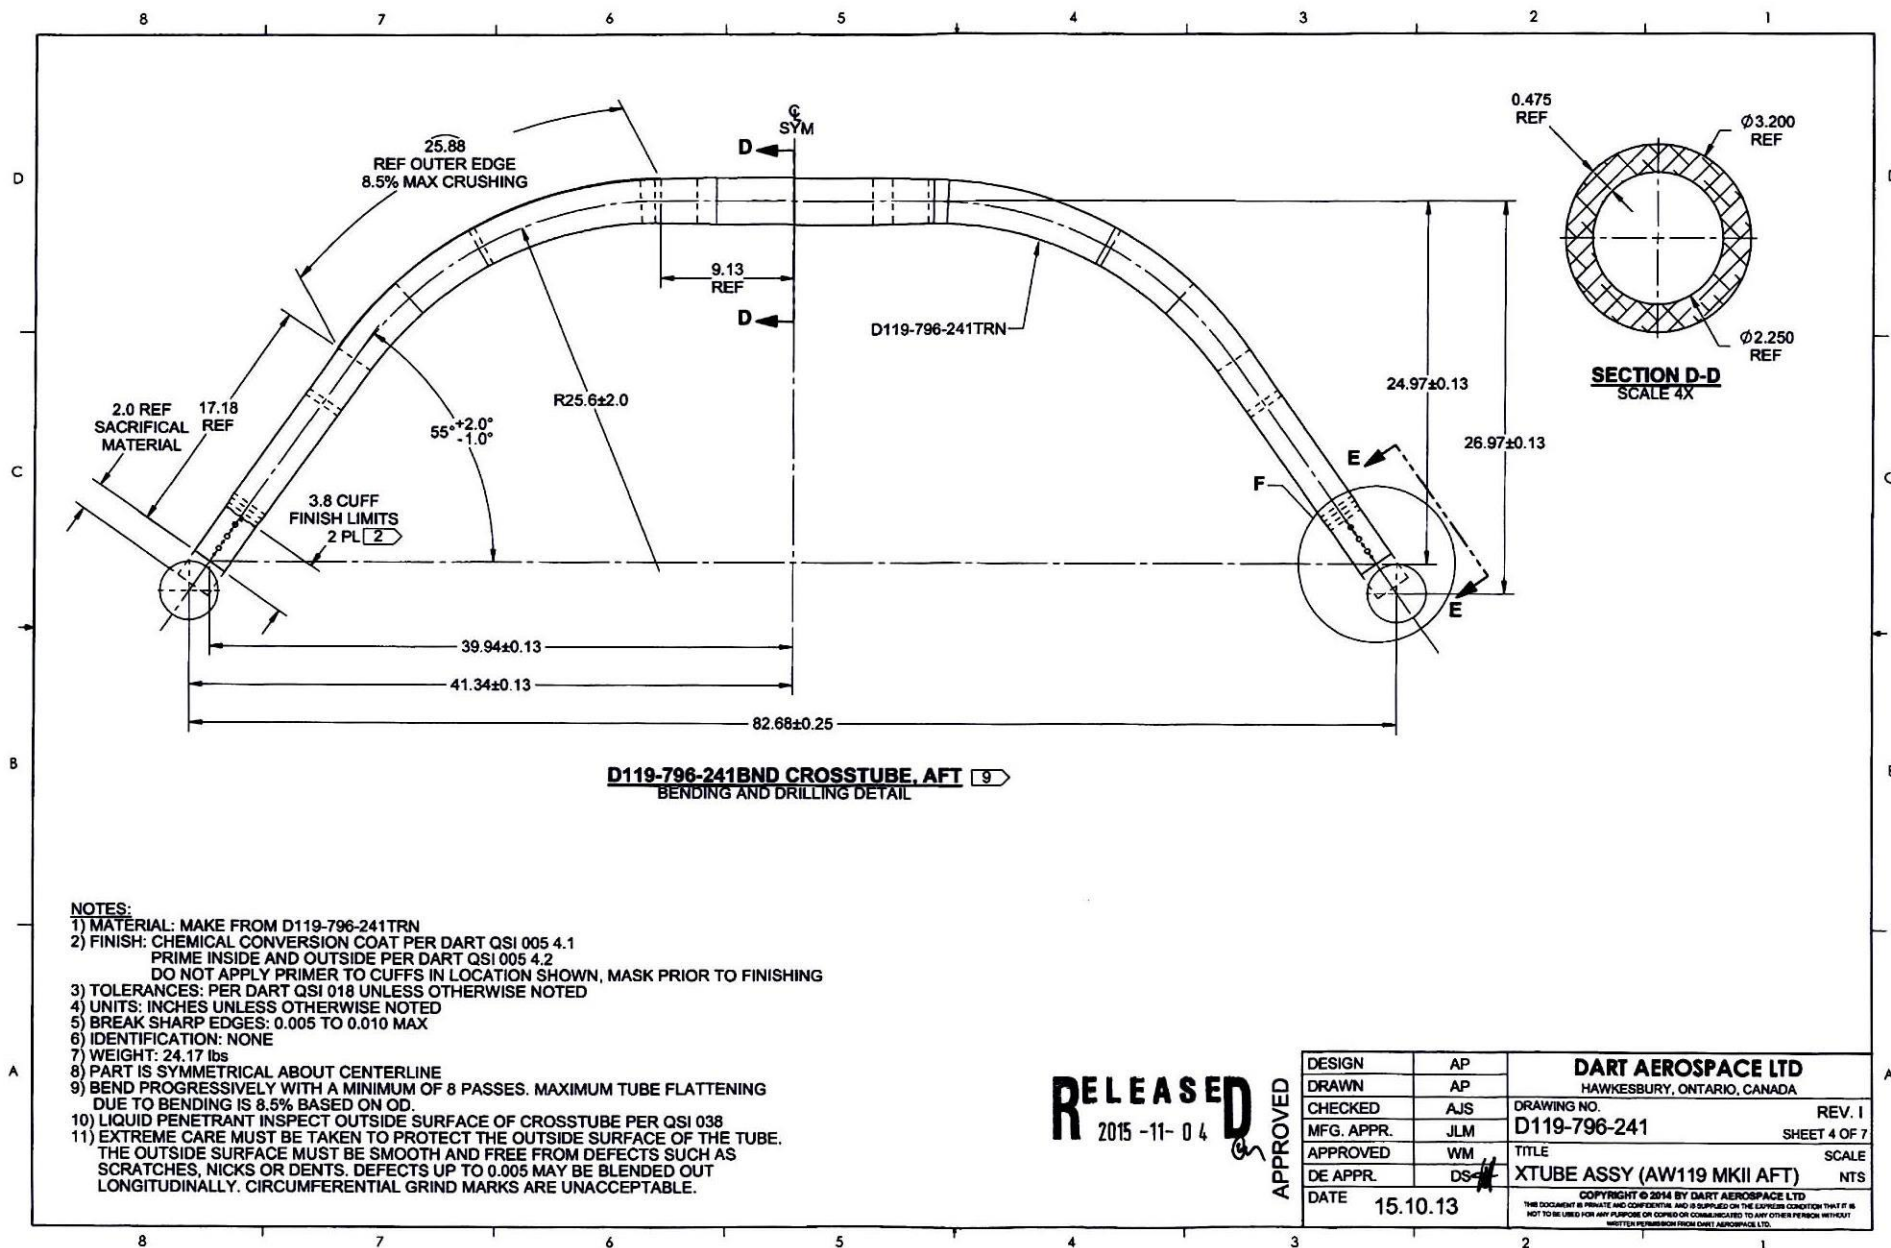

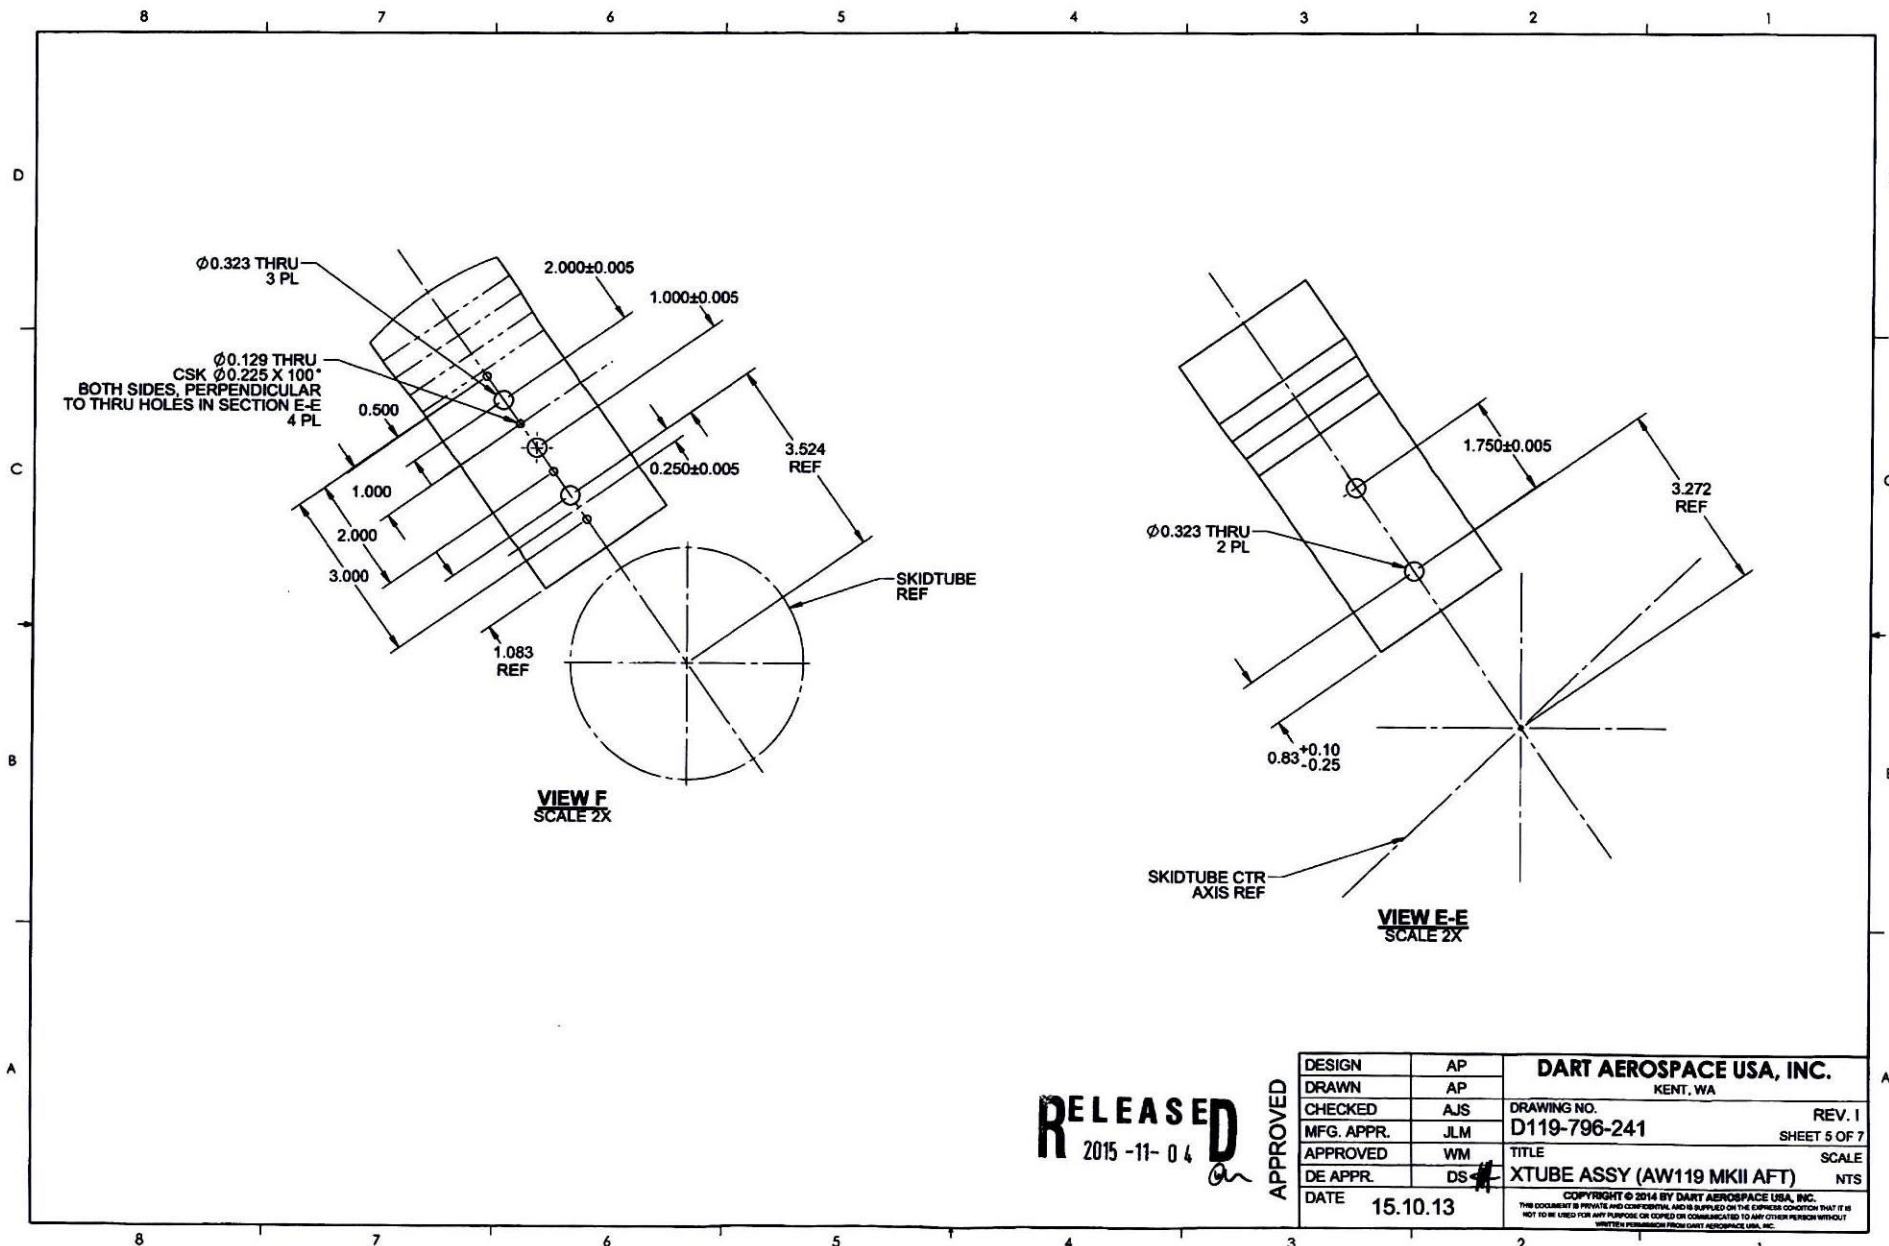


RELEASED
2015-11-04

DESIGN	AP	DART AEROSPACE USA, INC.	
DRAWN	AP	KENT, WA	
CHECKED	AJS	DRAWING NO.	REV. 1
MFG. APPR.	JLM	D119-796-241	SHEET 5 OF 7
APPROVED	WM	TITLE	SCALE
DE APPR.	DS	XTUBE ASSY (AW119 MKII AFT)	NTS
DATE	15.10.13	COPYRIGHT © 2014 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL, AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

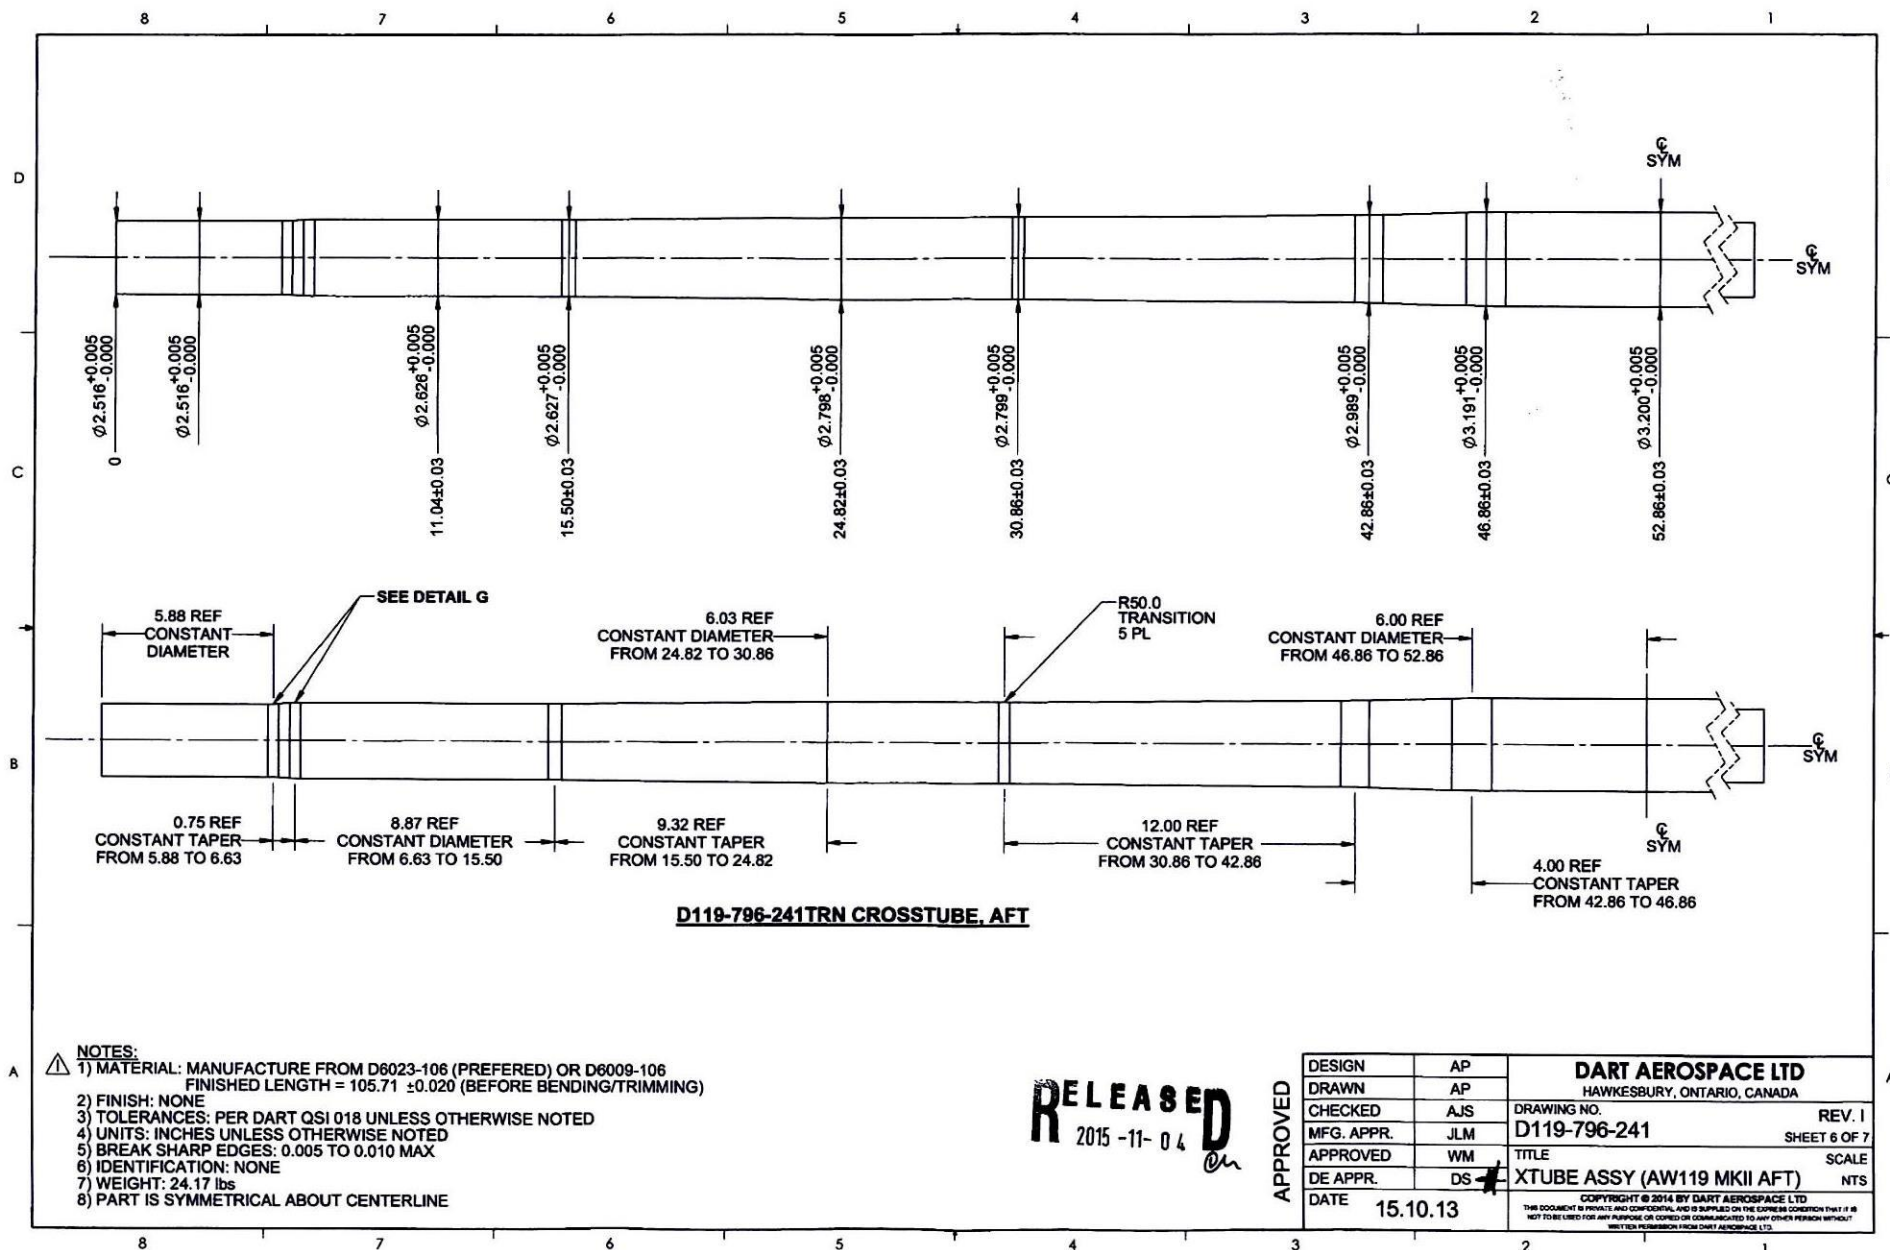


CHAMFER AS
REQUIRED FOR
TOOLING

DETAIL H
SCALE 4X

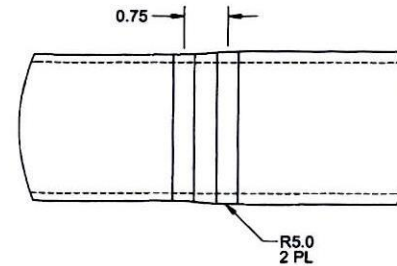

DETAIL G
SCALE 2X

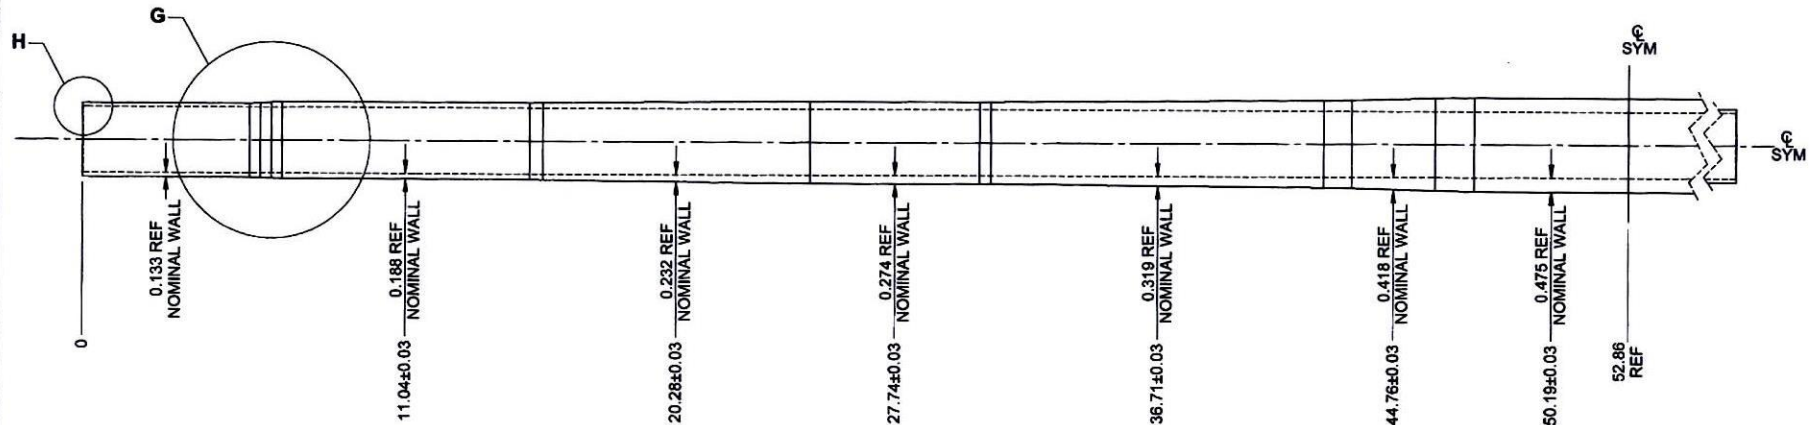

D119-796-241 TRN CROSSTUBE, AFT
SUPPLEMENTAL VIEW: NOMINAL WALL THICKNESS

RELEASED
2015-11-04
an
APPROVED

DESIGN	AP	DART AEROSPACE LTD	
DRAWN	AP	HAWKESBURY, ONTARIO, CANADA	
CHECKED	AJS	DRAWING NO.	REV. I
MFG. APPR.	JLM	D119-796-241	SHEET 7 OF 7
APPROVED	WM	TITLE	SCALE
DE APPR.	DS	XTUBE ASSY (AW119 MKII AFT)	NTS
DATE	15.10.13	COPYRIGHT © 2014 BY DART AEROSPACE LTD	
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.			